

Part Number: WP36BHD

Bright Red


Features

- T-1 PACKAGE WITH RECTANGULAR BASE.
- WITH BUILT-IN BLINKING IC.
- OPERATION VOLTAGE FROM 3.5V TO 14V.
- BLINKING FREQUENCY FROM 3.0Hz TO 1.5Hz.
- RoHS COMPLIANT.

Description

The Bright Red source color devices are made with Gallium Phosphide Red Light Emitting Diode.

Package Dimensions

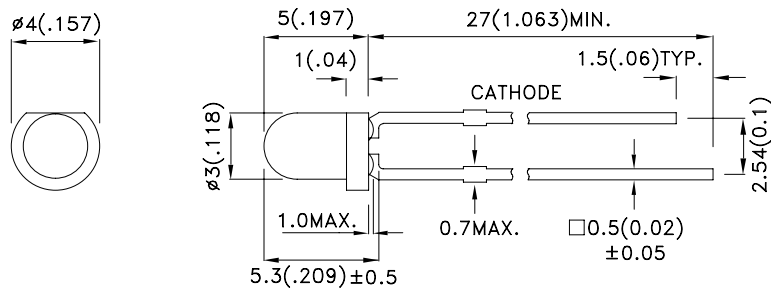

Notes:

1. All dimensions are in millimeters (inches).
2. Tolerance is $\pm 0.25(0.01)$ " unless otherwise noted.
3. Lead spacing is measured where the leads emerge from the package.
4. Specifications are subject to change without notice.



Selection Guide

| Part No. | Dice | Lens Type | Iv (mcd) V= 9V | | Viewing Angle [1] |
|----------|------------------|--------------|-------------------|------|-------------------|
| | | | Min. | Typ. | 2θ1/2 |
| WP36BHD | Bright Red (GaP) | RED DIFFUSED | 1 | 2 | 60° |

Note:

1. θ1/2 is the angle from optical centerline where the luminous intensity is 1/2 the optical centerline value.

Electrical / Optical Characteristics at TA=25°C


| Symbol | Parameter | Device | Min. | Typ. | Max. | Units | Test Conditions |
|--------|--------------------------|------------|------|------|------|-------|--------------------------|
| λpeak | Peak Wavelength | Bright Red | | 700 | | nm | |
| λD | Dominant Wavelength | Bright Red | | 660 | | nm | |
| Δλ1/2 | Spectral Line Half-width | Bright Red | | 45 | | nm | |
| IF | Forward Current | Bright Red | 8 | 22 | | mA | Min:VF=3.5V Typ:VF=5V |
| ISON | Supply Current | Bright Red | | 8 | | mA | VF=3.5V |
| ISON | Supply Current | Bright Red | | 44 | | mA | VF=14V |
| f | Blink Frequency | Bright Red | 1.5 | | 3 | Hz | VF=3.5V~14V |

Absolute Maximum Ratings at TA=25°C

| Parameter | Bright Red | Units |
|-----------------------------|---------------------|-------|
| Power dissipation | 310 | mW |
| Forward Voltage | 14 | V |
| Reverse Voltage | 0.5 | V |
| Operating Temperature | -40°C To +70°C | |
| Storage Temperature | -40°C To +85°C | |
| Lead Solder Temperature [1] | 260°C For 3 Seconds | |
| Lead Solder Temperature [2] | 260°C For 5 Seconds | |




Notes:

- 2mm below package base.
- 5mm below package base.

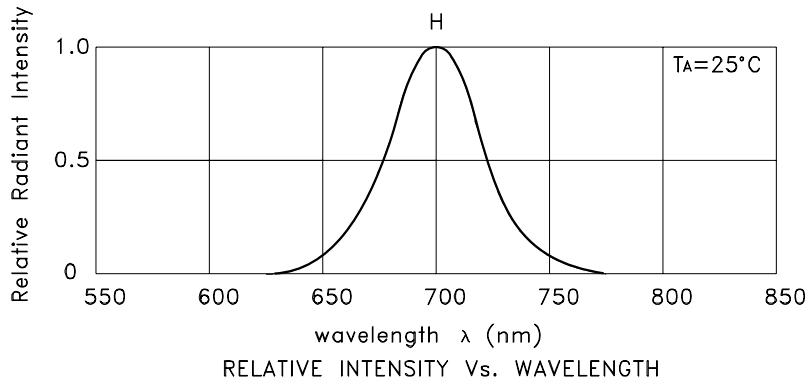


Bright Red

WP36BHD

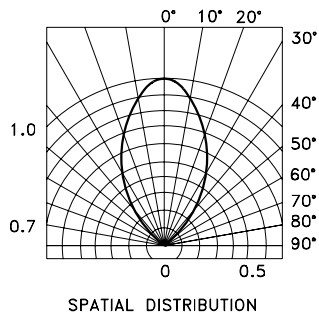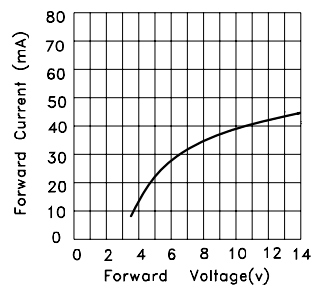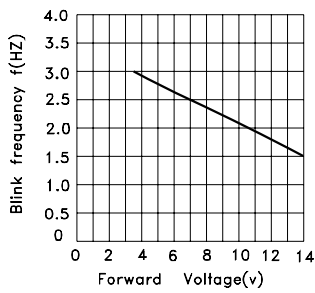

PACKING & LABEL SPECIFICATIONS

WP36BHD

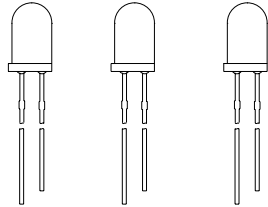


500PCS / BAG




20K / 9# BOX

OUTSIDE LABEL

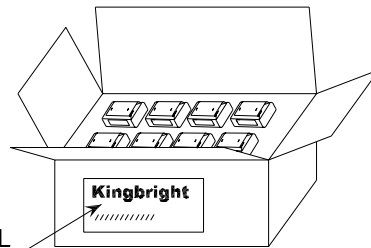

OUTSIDE LABEL

10K / 5# BOX

| | | | | |
|--|--|----|----------|--------|
| <h1>Kingbright</h1> | | | | |
| Q.C. | <table border="1"> <tr> <td style="text-align: center;">QC</td> </tr> <tr> <td style="text-align: center;">XX XX XX</td> </tr> <tr> <td style="text-align: center;">PASSED</td> </tr> </table> | QC | XX XX XX | PASSED |
| QC | | | | |
| XX XX XX | | | | |
| PASSED | | | | |
| TYPE NO : WP36Bxxx | | | | |
| QUANTITY : 500 pcs | | | | |
| S/N : XX | CODE: XX | | | |
| LOT NO :  | | | | |
| RoHS Compliant | | | | |

LED MOUNTING METHOD

1. The lead pitch of the LED must match the pitch of the mounting holes on the PCB during component placement. Lead-forming may be required to insure the lead pitch matches the hole pitch. Refer to the figure below for proper lead forming procedures.

(Fig. 1)



Fig.1

”O” Correct mounting method ”X” Incorrect mounting method

Note 1-2 : Do not route PCB trace in the contact area between the leadframe and the PCB to prevent short-circuits.

2. When soldering wire to the LED, use individual heat-shrink tubing to insulate the exposed leads to prevent accidental contact short-circuit.

(Fig. 2)



Fig. 2

3. Use stand-offs (Fig. 3) or spacers (Fig. 4) to securely position the LED above the PCB.



Fig. 3



Fig. 4

LEAD FORMING PROCEDURES

1. Maintain a minimum of 2mm clearance between the base of the LED lens and the first lead bend. (Fig. 5 and 6)



Fig. 5



Fig. 6

2. Lead forming or bending must be performed before soldering, never during or after Soldering.
3. Do not stress the LED lens during lead-forming in order to fractures in the lens epoxy and damage the internal structures.
4. During lead forming, use tools or jigs to hold the leads securely so that the bending force will not be transmitted to the LED lens and its internal structures. Do not perform lead forming once the component has been mounted onto the PCB. (Fig. 7)
5. Do not bend the leads more than twice. (Fig. 8)

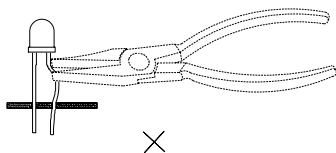


Fig. 7



Fig. 8

6. After soldering or other high-temperature assembly, allow the LED to cool down to 50°C before applying outside force (Fig. 9). In general, avoid placing excess force on the LED to avoid damage. For any questions please consult with Kingbright representative for proper handling procedures.



Fig. 9